

Data sheet article FE-Q-18-10-06

Technical data and application safety

Webcraft GmbH
 Industriepark 206
 78244 Gottmadingen, Germany


Phone: +49 7731 939 839 1

www.supermagnete.ee
 support@supermagnete.ee

1. Technical information

Block magnet 18 x 10 x 6 mm, holds approx. 630 g, ferrite, Y35, no coating

| | |
|-----------------------------|---|
| Article ID | FE-Q-18-10-06 |
| EAN | 7640155431842 |
| Material | Ferrite |
| Shape | Block |
| Size | 18 x 10 x 6 mm |
| Side 1 | 18 mm(+/- 0,2 mm) |
| Side 2 | 10 mm(+/- 0,2 mm) |
| Side 3 | 6 mm(+/- 0,1 mm) |
| Pole faces | 18 x 10 mm |
| Direction of magnetisation | Magnetised lengthwise |
| Coating | No coating |
| Manufacturing method | sintered |
| Magnetisation | Y35 |
| Strength | approx. 630 g (approx. 6,18 N) |
| Displacement force | approx. 130 g (approx. 1,24 N) |
| Max. working temperature | 250°C |
| Colour | Grey |
| Weight | 5,2380 g |
| Curie temperature | 450 °C |
| Residual magnetism Br | 4000-4100 G, 0.40-0.41 T |
| Coercive field strength bHc | 2.20-2.45 kOe, 175-195 kA/m |
| Coercive field strength iHc | 2.26-2.51 kOe, 180-200 kA/m |
| Energy product (BxH)max | 3.8-4.0 MGOe, 30.0-32.0 kJ/m ³ |

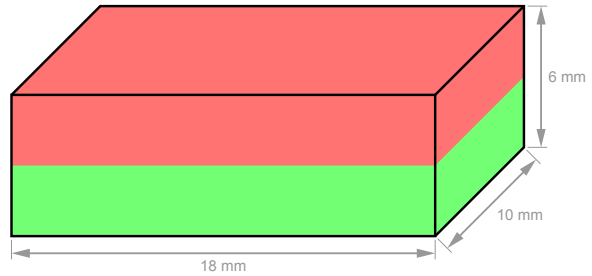



Product compliant with the latest European RoHS directive.




Product compliant with the latest European REACH regulation.


2. Safety tips


| | |
|---|---|
|  | Danger |
| | Swallowing |
| | <p>Children could swallow small magnets. If several magnets are swallowed, they could get stuck in the intestine and cause perilous complications.</p> <p>Magnets are not toys! Make sure that children don't play with magnets.</p> |


| | |
|---|--|
| Warning | Pacemaker |
|  | <p>Magnets could affect the functioning of pacemakers and implanted heart defibrillators.</p> <ul style="list-style-type: none"> • A pacemaker could switch into test mode and cause illness. • A heart defibrillator may stop working. |
| | <ul style="list-style-type: none"> • If you wear these devices keep sufficient distance to magnets: www.supermagnete.ee/eng/faq/distance • Warn others who wear these devices from getting too close to magnets. |

3. Handling and storing


| | |
|---|---|
| Caution | Magnetic field |
|  | <p>Magnets produce a far-reaching, strong magnetic field. They could damage TVs and laptops, computer hard drives, credit and ATM cards, data storage media, mechanical watches, hearing aids and speakers.</p> |
| | <ul style="list-style-type: none"> • Keep magnets away from devices and objects that could be damaged by strong magnetic fields. • Please refer to our table of recommended distances: www.supermagnete.ee/eng/faq/distance |


| | |
|---|--|
| Notice | Influence on people |
|  | <p>According to the current level of knowledge, magnetic fields of permanent magnets do not have a measurable positive or negative influence on people. It is unlikely that permanent magnets constitute a health risk, but it cannot be ruled out entirely.</p> |
| | <ul style="list-style-type: none"> • For your own safety, avoid constant contact with magnets. • Store large magnets at least one metre away from your body. |

| | |
|--|--|
| Notice | Temperature resistance |
|  | <p>Ferrite magnets can be used at temperatures between -40°C and 250°C. At lower and higher temperatures they lose part of their adhesive force permanently.</p> |
| | <p>Don't use ferrite magnets in places where they are exposed to temperatures below -40°C or above 250°C.</p> |

| | |
|---|---|
| Notice | Mechanical treatment |
|  | <p>Ferrite magnets are brittle. When drilling or sawing a magnet with improper tools, the magnet may break.</p> |
| | <p>Stay away from mechanical treatment of magnets if you do not possess the necessary equipment and experience.</p> |

4. Transportation tips

| | |
|---|--|
| Caution | Airfreight |
|  | <p>Magnetic fields of improperly packaged magnets could influence airplane navigation devices. In the worst case it could lead to an accident.</p> |
| | <ul style="list-style-type: none"> • Airfreight magnets only in packaging with sufficient magnetic shielding. • Please refer to the respective regulations: www.supermagnete.ee/eng/faq/airfreight |

| | |
|---|--|
| Caution | Postage |
|  | <p>Magnetic fields of improperly packaged magnets could cause disturbances in sorting machines and damage fragile goods in other packages.</p> |
| | <ul style="list-style-type: none"> • Please refer to our shipping tips: www.supermagnete.ee/eng/faq/shipping • Use a large box and place the magnet in the middle surrounded by lots of padding material. • Arrange magnets in a package in a way that the magnetic fields neutralise each other. • If necessary, use sheet iron to shield the magnetic field. • There are stricter rules for airfreight: Refer to the warning notice "Airfreight". |

TARIC-Code: 8505 1910 90 0

Origin: China

For more information about magnets please review
<https://www.supermagnete.ee/eng/faqs>.

Last update: 11/04/2026